


# CONGORILLA



Manual

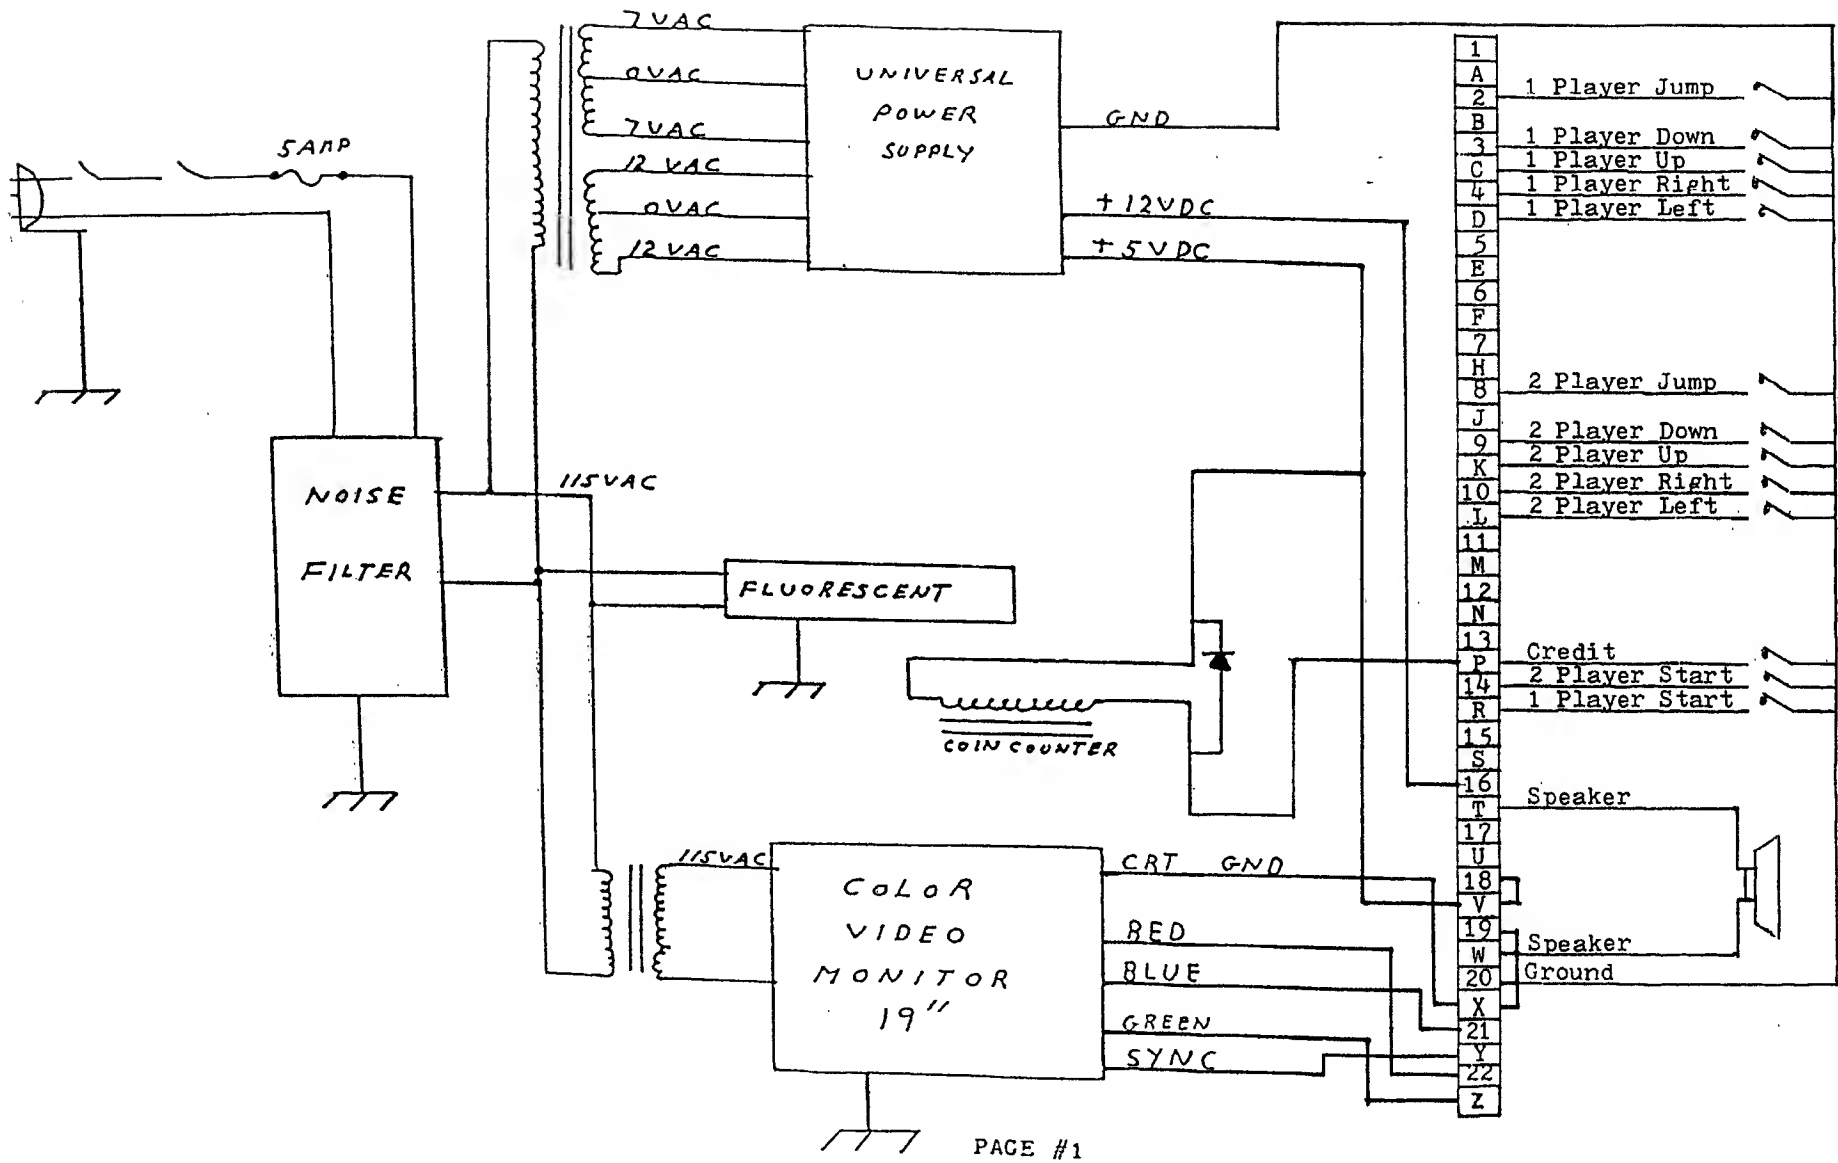

" CONGORILLA "

# " C O N G O R I L L A "

## Power Supply Connections

### Socket P-1

1	12 VAC
2	
3	12 VAC
4	12 VCT
5	
6	7 VAC
7	7 VAC
8	
9	7 VCT

### Socket P-2

1	Gnd
2	
3	Gnd
4	-12 VDC
5	
6	-20 VDC un reg
7	-5 VDC
8	
9	+20 VDC un reg
10	+5 VDC
11	
12	-10 VDC un reg
13	+12 VDC
14	
15	+9 VDC un reg

### BIT SWITCH OPTIONS

Sw / Function	1	2	3	4	5	6	7	8
3 Gorillas	OFF	OFF						
4 Gorillas	ON	OFF						
5 Gorillas	OFF	ON						
6 Gorillas	ON	ON						
Bonus Gorilla @								
7000 Points			OFF	OFF				
10000 Points			ON	OFF				
15000 Points			OFF	ON				
20000 Pcints			ON	ON				
1 Coin 1 Play					OFF	OFF	OFF	
1 Coin 2 Play					OFF	ON	OFF	
1 Coin 3 Play					OFF	OFF	ON	
1 Coin 4 Play					OFF	ON	ON	
2 Coin 1 Play					ON	OFF	OFF	
3 Coin 1 Play					ON	ON	OFF	
4 Coin 1 Play					ON	OFF	ON	
5 Coin 1 Play					ON	ON	ON	
Up Right								ON
Table								OFF

" C O N G O R I L L A "  
Edge Connector Harness

1		A	
2	1 Player Jump	B	
3	1 Player Down	C	1 Player Up
4	1 Player Right	D	1 Player Left
5		E	
6		F	
7		H	
8	* 2 Player Jump	J	
9	* 2 Player Down	K	* 2 Player Up
10	* 2 Player Right	L	* 2 Player Left
11		M	
12		N	
13		P	Credit
14	2 Player Start	R	1 Player Start
15		S	
16	+12 VDC	T	Speaker
17		U	Coin Counter
18	+5 VDC	V	+5 VDC
19	Pwr Gnd	W	Speaker
20	Gnd	X	Video Gnd
21	Video Blue	Y	Sync
22	Video Red	Z	Video Green

\* For cocktail table only, make following wire modifications.

9     2 Player Up  
10    2 Player Left  
K     2 Player Down  
L     2 Player Right

Number side is component side.  
Letter side is solder side.

UNIVERSAL POWER SUPPLY  
Outline Drawing

Page #4

